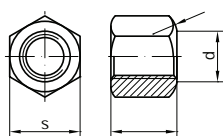
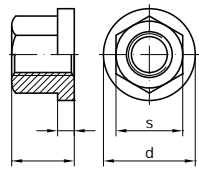


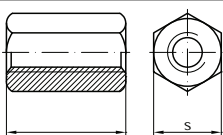


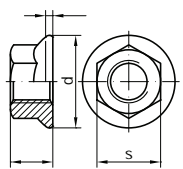
Dimensions for nuts

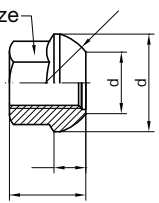
Hexagon nuts


DIN	Dimensions	M 6	M 8	M 10	M 12	M 14	M 16
6330 	d ₁	7	9	11.5	14	16	18
	m	9	12	15	18	21	24
	r	9	11	15	17	20	22
	s	10	13	16	18	22	24
	Dimensions	M 18	M 20	M 22	M 24	M 27	M 30
	d ₁	20	22	25	26	29	32
	m	27	30	33	36	40	45
	r	25	27	29	32	37	41
	s	27	30	32	36	41	46

DIN	Dimensions	M 6	M 8	M 10	M 12	M 14	M 16	M 18
6331 	a	3	3.5	4	4	4	5	5
	d ₁	14	18	22	25	28	31	34
	m	9	12	15	18	21	24	27
	s	10	13	16	18	22	24	27
	Dimensions	M 20	M 22	M 24	M 27	M 30	M 36	M 42
	a	6	6	6	7	8	10	12
	d ₁	37	40	45	50	58	68	80
	m	30	33	36	40	45	54	63
	s	30	32	36	41	46	55	65

~ DIN	Dimensions	M 6	M 8	M 10	M 12	M 16	M 20	M 24	M 30
6334 	m	18	24	30	36	48	60	72	90
	s	10	13	17	19	24	30	36	46

DIN	Dimensions	M 4	M 5	M 6	M 8	M 10	M 12	M 16	M 20
6923 	d _{c max}	10	11.8	14.2	17.9	21.8	26	34.5	42.8
	m _{max}	4.65	5	6	8	10	12	16	20
	s	7	8	10	13	15	18	24	30

DIN	Dimensions	M 18x1.5	M 20x1.5
74361A 	d ₁	28	33
	d ₂	21	24.5
	h ₁	25	27
	h ₂	75	9
	r	16	18
	wrench size	24	27

DIN	Dimensions	M 14x1.5	M 18x1.5	M 20x1.5	M 22x1.5
74361 B 	d ₁	27	29	34	36
	h ₁	15	18	20	22
	h ₂	3	4	5	6
	wrench size	19	24	27	30