



Dimensions for screws and bolts

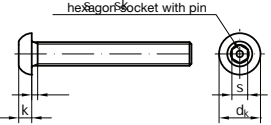


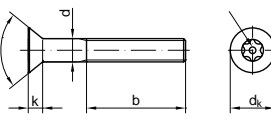
Note: When inquiring about 5 digit part numbers beginning with 8, please preface the number with R264-. Example: 88111 should be R264-88111.

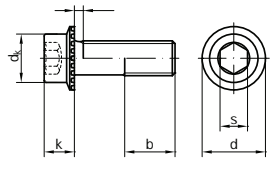
Theft resistant screws/locking screws

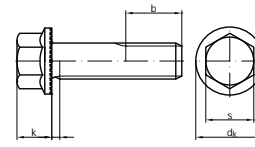
R264 - article	Dimensions	M 3	M 4	M 5	M 6
88111 	b_{min}	25	38	38	38
	d_K	6	8	10	12
	k	1.8	2.4	3	3.6

R264 - article	Dimensions	M 3	M 4	M 5	M 6
88112 	b_{min}	19	22	25	28
	d_K	5.6	7.5	9.2	11
	k	1.65	2.2	2.5	3

R264 - article	Dimensions	M 3	M 4	M 5	M 6	M 8	M 10	M 12
88113 	a_{min}	0.5	0.7	0.8	1	1.25	1.5	1.75
	$d_{K max}$	5.7	7.6	9.5	10.5	14	17.5	21
	k_{min}	1.4	1.95	2.5	3	4.1	5.2	6.24
	s	1.65	2.2	2.5	3	3	3	3

R264 - article	Dimensions	M 3	M 3.5	M 4	M 5	M 6	M 8	M 10
88117  b ₁) for lengths l ≤ 125 mm b ₂) for lengths l >125 ≤ 200 mm b ₃) for lengths l > 200 mm	$d_{K max}$	6	7	8	10	12	16	20
	$d_{s min}$	2.86	3.32	3.82	4.82	5.82	7.78	9.78
	k_{max}	1.7	2	2.3	2.8	3.3	4.4	5.5
	TORX size	T10	T15	T20	T25	T30	T40	T45
	b_1	12	12	14	16	18	22	26
	b_2	-	-	-	-	24	28	32
	b_3	-	-	-	-	-	-	45

R264 - article	Dimensions	M 5	M 6	M 8	M 10	M 12
88912  hexagon socket cap screws with flange and ribs	a_{max}	2.4	3.0	3.7	4.5	5.2
	b	22	24	28	32	36
	d_c	11	13.5	17	19.5	22.5
	d_K	9	11	14	17	19
	k	5	6	8	10	12
	s	4	5	6	8	10
	qty. ribs	28	36	48	60	72

R264 - article	Dimensions	M 5	M 6	M 8	M 10	M 12	M 14	M 16
88913  hexagon head screws with flange and ribs b ₁) for lengths l ≤ 125 mm b ₂) for lengths l >125 ≤ 200 mm	a_{max}	1.6	2	2.5	3	3.5	4	4
	b_1	16	18	22	26	30	34	38
	b_2	22	24	28	32	36	40	44
	d_K	11.2	14.2	18.2	21	24	27.5	31
	k	4.3	5.5	7	8.5	10	12	14
	s	8	10	13	15	17	19	22
	qty. ribs	28	36	48	48	60	60	72

R264 - article	Dimensions	M 5	M 6	M 8	M 10	M 12	M 14	M 16
88933  hexagon head locking screws	d_c	11.2	14.25	18.25	21	24	27.5	31
	h_{min}	0.15	0.17	0.2	0.25	0.25	0.25	0.28
	k	4.3	5.5	7	7.9	8.7	10.2	11.2
	s	8	10	13	15	17	19	22
	qty. serrations	24	24	24	24	24	24	24