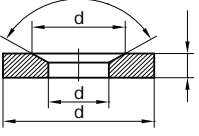


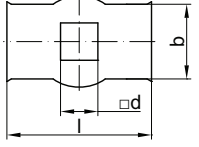
Dimensions for washers and rings

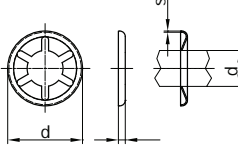


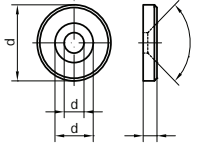
Note: When inquiring about 5 digit part numbers beginning with 8, please preface the number with R264-. Example: 88111 should be R264-88111.

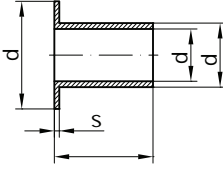
Special forms

DIN	Dimensions	12	14.2	19	23.2	28	35
6319-G  d ₂ = nominal size	d ₄	30	36	44	50	60	68
	d ₅	18.5	20	26	31	37	49
	h ₃	5	6	7	8	10	12

R264 - ARTICLE	Dimensions	9	11
88102  joint washers for DIN 603	b	22	22
	l	40	40
	□ d	9	11
	for screws	M 8	M 10

R264 - ARTICLE	Dimensions	3	4	5	6	8	10	12
88122  axle locking rings d ₁ = nominal size	d ₂	11	11	11	15	15	18	25
	h	1.3	1.3	1.3	1.6	1.6	2.1	3.0
	s	0.2	0.2	0.2	0.25	0.25	0.3	0.4
	F _a	200 N	400 N	600 N	800 N	1000 N	1100 N	2500 N

R264 - ARTICLE	Dimensions	16	20	25	28	36	45	52
88184  machine washers for ISO 2009/10642 d ₁ = nominal size	d ₂	4.3	4.3	5.3	5.3	6.4	6.4	6.4
	d ₃	8	8	10	10	12	12	12
	h	3	3	3.5	3.5	4	6	6
	for screws	M 4	M4	M 5	M 5	M 6	M6	M 6

R264 - ARTICLE	Dimensions	M 4/10	M 4/15	M 4/20	M 5/10	M 5/15	M 5/20	M 6/10	M 6/15
88498  KORREX insulating tubes	for screws	M 4	M 4	M 4	M 5	M 5	M 5	M 6	M 6
	l	10	15	20	10	15	20	10	15
	d ₁	4.3	4.3	4.3	5.3	5.3	5.3	6.5	6.5
	d ₂	5.8	5.8	5.8	6.8	6.8	6.8	8	8
	d ₃	9.5	9.5	9.5	12	12	12	13	13
	s	1	1	1	1	1	1	1	1
	Dimensions	M 6/20	M 8/10	M 8/15	M 8/22	M 10/10	M 10/20	M 10/25	M 12/15
	for screws	M 6	M 8	M 8	M 8	M 10	M 10	M 10	M 12
	l	20	10	15	22	10	20	25	15
	d ₁	6.5	8.2	8.2	8.2	10.2	10.2	10.2	12.3
	d ₂	8	10.4	10.4	10.4	12.5	12.5	12.5	15
	d ₃	13	18	18	18	21	21	21	24
	s	1	1	1	1	1	1	1	1
	Dimensions	M 12/25	M 16/10	M 16/15	M 16/20	M 16/25	M 20/15	M 20/20	M 20/25
	for screws	M 12	M 16	M 16	M 16	M 16	M 20	M 20	M 20
	l	25	10	15	20	25	15	20	25
	d ₁	12.3	16.3	16.3	16.3	16.3	20.3	20.3	20.3
	d ₂	15	19.3	19.3	19.3	19.3	23.3	23.3	23.3
d ₃	24	30	30	30	30	36	36	36	
s	1	2	2	2	2	2	2	2	